

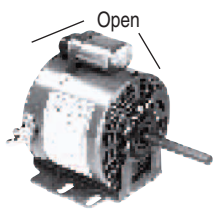
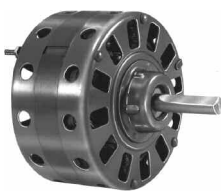






One-On-One™ Direct Replacement Motors

	MARS NO.	MFG. NO	HP	VOLTS	RPM/SPEEDS	ROT	AMPS	DIMENSIONS		
								A	B	C
Hill Refrigeration (con't)										
	05095	5KSM81FFL0036	5W	115	1550/1	CW OSE	.45	.5	2.5	-
	3 1/2 inch diam., totally enclosed, 3 tapped holes, shaded pole, 1/4 inch threaded shaft									
	Replaces: 5KSP51AL486H, 5KSM51AG3005, Hill No. PP7577 Also Replaces: 5KSP51AL380H used by WARREN									
	05096	5KSM81FFL0036	5W	115	1550/1	CW OSE	.45	.5	2.5	-
	3 1/2 inch diam., totally enclosed, 3 tapped holes, shaded pole, 1/4 inch threaded shaft with 90° Lyall plug									
	Replaces: 5KSP51AL486H, 5KSM51AG3005, Hill No. PP7577 Also Replaces: 5KSP51AL380H used by WARREN									
	X230	048A17O136	1/3	208-230	1625/1	CW	1.8	3.50	4.75	-
	48Y frame, open air over, resilient base, ball bearings, capacitor included									
	Replaces: Magnetek 160, Steveco S3001, FASCO D801, GE 5KCP39KG1369S List Price \$168, Mult. Symbol F1									
Honeywell Air Cleaner										
	D1054	-	1/12 - 1/20 - 1/25	115	1050/3	CW SE	3.1 - 2.1 - 1.5	2.50	2.62	-
	Shaded pole, sleeve bearing									
	Replaces: 190386A; 5KSP29DK1906S									
Hussman										
	D807	-	1/6	208 - 230	1625/1	CCW SE	1.2	4.88	3.75	-
	PSC, ball bearing, 4@370V capacitor required (MARS No. 12004)									
	Replaces: 5KCP39EGC244T, 5KSP39FG4771S									
	D890	-	1/2	208 - 230	1725/1	CCW SE	2.7	3.50	4.50	-
	PSC, sleeve bearing									
	Replaces: 259983, K55HXCTP-9963									