
WIRING INSTRUCTIONS

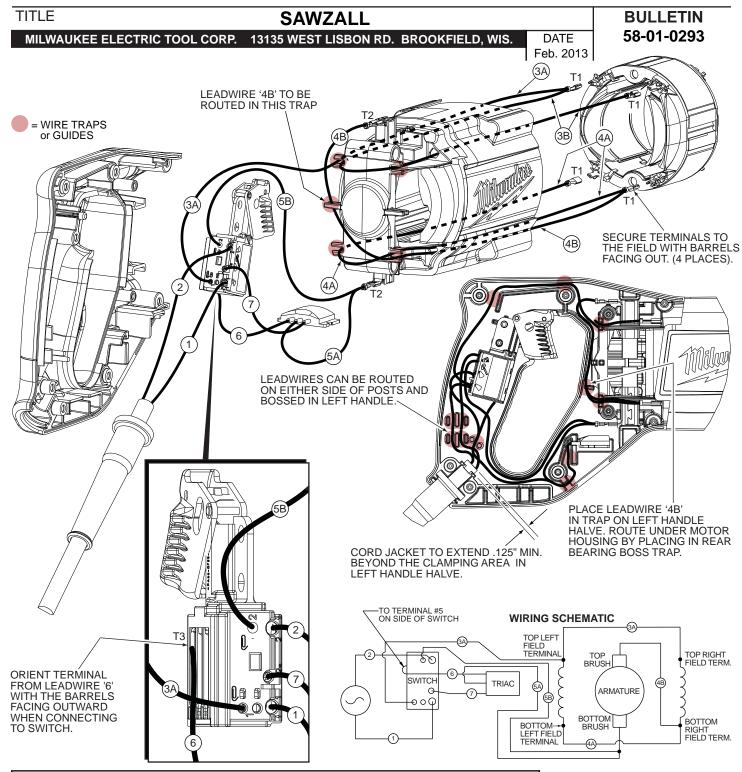

WIRING SPECIFICATIONS						
Wire	Wire Color	Origin or	Longth	Terminals, Connectors and 1 or 2 End Wire Preparation		
No.		Gauge	Length	,		
1	White	Cordset	3-1/4"	Strip 5/16" and tin. Connect to '1↑' on switch.		
2	Black	Cordset	3-3/4"	Strip 5/16" and tin. Connect to '2↑' on switch.		
ЗА	White	23-94-0520		From the top left field position, connect tinned end to '1' on switch.		
3B	White	23-94-0520		From top left field position, connect terminal to top right field position.		
4A	Black	23-94-0510		From bottom right field position, connect terminal to bottom left field position.		
4B	Black	23-94-0510		From the bottom right field position, connect terminal to top brush.		
5A	Yellow	Remote Mod.		Terminated with 5B. Connect terminal T2 to bottom brush.		
5B	Red	Remote Mod.		Terminated with 5A. Connect tinned end to '2' on switch.		
6	Black	Remote Mod.		Connect to '5' on right side of switch.		
7	Blue	Remote Mod.		Connect tinned end to '2a' on switch.		

NOTE: All leads must be held to ± 1/8". All lead lengths are before stripping.

TERMINAL DESCRIPTION						
Code	Part No.	Qnty.				
T1	23-94-1060	4				
T2	23-94-0017	2				
T3	23-94-0010	1				